



**MINISTRY OF TRANSPORT OF THE RUSSIAN FEDERATION
FEDERAL AGENCY OF SEA AND RIVER TRANSPORT
FEDERAL STATE BUDGETARY INSTITUTION
«BLACK SEA MARITIME PORTS ADMINISTRATION»
(FSBI «BLACK SEA MPA»)**

Form A

**REPORT OF INSPECTION IN ACCORDANCE WITH
THE BLACK SEA MEMORANDUM OF UNDERSTANDING ON PORT STATE CONTROL***

2, Khvorostyansky Str.,
Novorossiysk, 353925, Russia
Tel. +7 (8617) 676368
Fax. +7 (8617) 676378
E-mail: capasist@amprnovo.ru

copy to: master
head office
PSCO
if ship is detained, copy to:
flag State
IMO
recognized organization, if applicable

1. name of ship NODUS 2. flag of ship LIBERIA 3. type of ship GEN. CARGO
4. call sign/MMSI 25VR3/636019688 5. IMO number 9497464 6. gross tonnage 22004
7. deadweight 33421 8. year of build KOR. REG 9. date of inspection 18.12.19
10. place of inspection Novorossiysk 11. classification society 2009 12. date of release from detention
13a. IMO company number 5485361 13b. particulars of company SEDAR SHIPMANAGE
ment SA. Greece
14. name and signature of master to certify that the information under 13 is correct
name Capt. Babayev O. signature [Signature]

15.** type of inspection: ☐ initial inspection ☒ more detailed inspection ☐ expanded inspection

16. operational control (if any): ☐ abandon ship drill ☐ SOPEP drill
☐ fire drill ☐ SMPEP drill
☐ damage control drill ☐ other RESURDOAT ENG. ST.

17. areas inspected:

☒ navigational bridge ☒ engine room ☒ accommodation and galley
☒ passenger spaces ☒ steering-room ☒ decks and forecastle
☐ cargo hold(s)/tank(s) ☐ vehicle deck
☐ ballast tank(s) internal ☐ ballast tank(s) from manhole

18. list of relevant certificate(s)

code	title	issuing authority	date of issue	date of expiry	date of survey	surveying authority	surveyed place
501	Cargo Ship Safety Construction	KR	14/12/19	12/10/20			
502	Cargo Ship Safety Equipmen	KR	14/12/19	12/10/20			
503	Cargo Ship Safety Radio	KR	09/05/17	12/10/20	22/09/18	KR	CANAKKALE
505	International Oil Pollution Prevention	KR	14/12/19	17/07/22			
506	International Air Pollution Prevention	KR	14/12/19	12/10/20			
507	International Sewage Pollution Prevention	KR	14/12/19	12/10/20			
508	Load Lines	KR	14/12/19	12/10/20			
509	Document of Compliance	FW	04/12/19	08/04/24			
510	Safety Management Certificate	FW	12/12/19	12/06/20			
511	International Ship Security Certificate	FW	12/12/19	12/07/20			
512	Minimum Safe Manning Document	FW	09/12/19				
523	Tonnage	KR	15/06/17				
528	International Ballast Water Management	FW	10/12/19	17/07/22	12/12/19	FW	ISB.
533	Maritime Labour Certificate	FW	12/12/19	12/06/20			

19. inspection actions taken:

☐ 26 - competent security authority informed ☒ 70 - recognized organization informed
☐ 27 - ship expelled on security grounds ☐ 85 - investigation of contravention of discharge provisions (MARPOL)
☐ 40 - next port informed ☐ 151 - ILO informed
☐ 45 - rectify detainable deficiencies at next port ☐ 152 - seafarer organization informed
☐ 50 - flag State/consul informed ☐ 155 - ship owner organization informed
☐ 55 - flag State consulted

20. deficiencies

☐ no ☒ yes (see attached FORM B) Pages 2

21. outstanding deficiencies***

☒ no ☐ yes

22. ship detained

☒ no ☐ yes

23. supporting documentation

☒ no ☐ yes (see annex)

Issuing officeNovorossiysk PSC.....

PSCO name Port State Control

Issuing officeFSBI «BLACK SEA MPA».....

Address: 2, Khvorostyansky Str., Novorossiysk, 353925, Russia

Telephone:+7 (8617) 676368.....

E-mail: capasist@amprnovo.ru

PSCO name(s)

Signature(s):

This report must be retained on board for period of two years and must be available for consultation by Port State Control Officers at all times.

* This inspection report has been issued solely for the purpose of informing the master and other port States that an inspection by the port State, mentioned in the heading, has taken place. This inspection report cannot be construed as a seaworthiness certificate in excess of the certificates the ship is required to carry

** Masters, Shipowners and/or Operators are advised that detailed information on the inspection will be reported to the appropriate authorities and organisations and is subject to publications

*** Outstanding deficiencies are listed for information only and will not be taken into account for the calculation of the Ship Risk Profile and the Company performance.

Exhibit B



MINISTRY OF TRANSPORT OF THE RUSSIAN FEDERATION
FEDERAL AGENCY OF SEA AND RIVER TRANSPORT
FEDERAL STATE BUDGETARY INSTITUTION
«BLACK SEA MARITIME PORTS ADMINISTRATION»
(FSBI «BLACK SEA MPA»)

Form B

REPORT OF INSPECTION IN ACCORDANCE WITH
THE BLACK SEA MEMORANDUM OF UNDERSTANDING ON PORT STATE CONTROL

2, Khvorostyansky Str.,
Novorossiysk, 353925, Russia
Tel. +7 (8617) 676368
Fax. +7 (8617) 676378

E-mail: capasist@amprnovo.ru

copy to: master
head office
PSCO
if ship is detained, copy to:
flag State
IMO
recognized organization, if applicable

1. name of ship NODUS 5. IMO number 9497464
9. date of inspection 18.12.2019 10. place of inspection Novorossiysk
24. list of deficiencies

No	code	nature of defect 1)	convention 2)	action(s) taken 3)	responsible RO	ISM relat.	accidental damage 4)
1	10109	SOME NAVIGATION LIGHTS UNLIT		17	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
2	10109	RUSSIAN FLAG DIRTY, DAMAGED, NATIONAL NOT KEEP.		17	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
3	13199	STEAM BOILER LEAK OF OIL		17/70	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
4	13199	STEAM BOILER AUT. SYSTEM OUT OF ORDER		17/70	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
5	13104	BKGE PUMP OUT OF ORDER		17/70	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
6	02107	HYDR. SYSTEM OF BALLAST VALVE LEAK		17/70	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
7	13101	ME CHAINDER LEAK OF COOKING WATER		17/70	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
8	13108	ME HT FW PUMP N2 OUT OF ORDER		17/70	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
9	13199	ME LO PUMP N2 OUT OF ORDER		17/70	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
10	14501	GARBAGE KEEP NOT AS REQUIRED		17	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
11	10109	ST. BOARD SIDE NAV. LIGHT FOUND CORRODED		16	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
12	18414	PROVISION CRANE HOOK MATCH MISSING		17	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
13	11104	RESCUE BOAT SWIT-CHES NOT PROTECTED		17	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
14	10101	PILOT LADDER ROPE POOR		17/70	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
15	03105	HYDRAULIC PIPES ON CARGO DECK CORRODED, TEMPORARY REPAIRED, NEAR HOLD N4 p/s.		17/70	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

Name _____ (duty authorized PSCO of reporting authority)
Signature _____ I.G. MUZYKA Surveyor MOL
Novorossiysk

- 1) This inspection was not a full survey and deficiencies listed may not be exhaustive. In the event of a detention, it is recommended that full survey is carried out and all deficiencies are rectified before an application for re-inspection is made.
2) To be completed in the event of a detention.
3) Applicable Deficiency Action Codes (see reverse side of copy) to be entered.
4) Deficiencies marked as Accidental Damage are not taken into account for calculation the company performance and the Ship Risk Profile

Page of 12

Exhibit B



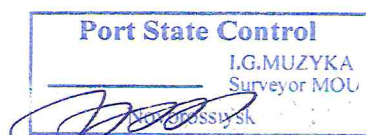
**REPORT OF INSPECTION IN ACCORDANCE WITH
THE BLACK SEA MEMORANDUM OF UNDERSTANDING ON PORT STATE CONTROL**

2, Khvorostyansky Str.,
Novorossiysk, 353925, Russia
Tel. +7 (8617) 676368
Fax. +7 (8617) 676378

E-mail: capasist@ampnovo.ru

copy to: master
head office
PSCO
if ship is detained, copy to:
flag State
IMO
recognized organization, if applicable

1. name of ship МОДУС 5. IMO number 9497464
9. date of inspection 18.12.2019 10. place of inspection Novorossiysk
24. list of deficiencies

[illegible]

Name _____
(duly authorized PSCO of reporting authority)

Signature _____
A.G. Grishko
Sergeyevskiy

- 1) This inspection was not a full survey and deficiencies listed may not be exhaustive. In the event of a detention, it is recommended that full survey is carried out and all deficiencies are rectified before an application for re-inspection is made.
- 2) To be completed in the event of a detention.
- 3) Applicable Deficiency Action Codes (see reverse side of copy) to be entered.
- 4) Deficiencies marked as Accidental Damage are not taken into account for calculation the company performance and the Ship Risk Profile